

Date: Monday, 11/6/2006 1:55:54 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : 206L/L3/L4 HIGH GEAR SKID
Job Number : 29321	
Estimate Number : 10526	
P.O. Number : N/A	Part Number : D206642412
This Issue : 11/6/2006 S.O. No. : N/A	Drawing Number : N/A
Prsht Rev. : NC	Project Number : N/A
First Issue : N/A Type : LANDING GEAR	Drawing Revision : N/A
Previous Run : 29319	Material : N/A
Written By : _____	Due Date : 11/30/2006 Qty: 1 Um: Each
Checked & Approved By : <u>06 11 07</u>	
Comment : Est Rev:K 05.10.11 Revised picklist per CHG004 KJ/CP/JLM	

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------

**Comment:** DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-412 CHG004

06-11-07 ①

2.0	29321A	206 L HIGH GEAR SKIDTUBE
-----	--------	--------------------------

**Comment:** Sub-Component 206 L HIGH GEAR SKIDTUBED206-642-441 B 29321A

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------

**Comment:** PACKAGING RESOURCE #1

Pick Packing Kit

4.0	D2652	Bushing
-----	-------	---------

**Comment:** Qty.: 24.0000 Each(s)/Unit Total : 24.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

24 D2652 Bushing 328933 ✓1 D206-642-441(REF) B29321A

5.0	D2655	Ring
-----	-------	------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D2655 Tow Ring B28856 ✓

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:55:54 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L/L3/L4 HIGH GEAR SKID

Job Number: 29321

Part Number: D206642412

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

D2659

Lug Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2659 Lug Assembly B29228

7.0

D2712

Set Screw



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

10 D2712 Set Screw B26481

8.0

D29322

206 Saddle Right side



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D2932-2 Saddle B29231

9.0

D29332

206 Saddle Right



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D2933-2 Saddle B30487

10.0

D2934

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2934 Saddle Spacer B29345

11.0

D2935

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2935 Saddle Spacer B29346

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:55:54 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L/L/L3/L4 HIGH GEAR SKID

Job Number: 29321

Part Number: D206642412

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

D29382

206 Saddle Right side



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 D2938-2

Saddle

B28863 ✓

13.0

D29392

206 Saddle Right Side



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 D2939-2

Saddle

B28864 ✓

14.0

D2968043

Tow Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 D2968-043

Tow Ring

B28865 ✓

15.0

AN337A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN3-37A

Bolt

M14478 ✓

16.0

AN341A

Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN3-41A

Bolt

M101938 ✓

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:55:55 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L/L/L3/L4 HIGH GEAR SKID

Job Number: 29321

Part Number: D206642412

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

AN45A

Bolt



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 AN4-5A

Bolt M100857 ✓

18.0

AN46A

Bolt



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

12 AN4-6A

Bolt M102959 ✓

19.0

AN511A

Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN5-11A

Bolt M101291

20.0

AN512A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-12A

Bolt M102380 ✓

21.0

AN513A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-13A

Bolt M15928 ✓

22.0

AN960JD10

Washer



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

12 AN960JD10

Washer M100274 ✓

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:55:55 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L/L3/L4 HIGH GEAR SKID

Job Number: 29321

Part Number: D206642412

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

AN960JD1016

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Qty Part Number

Description Batch

1 AN960JD1016

Washer MS519 ✓

24.0

AN960JD416

Washer



Comment: Qty.: 25.0000 Each(s)/Unit Total : 25.0000 Each(s)

Qty Part Number

Description Batch

25 AN960JD416

Washer M101938 ✓

25.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Qty Part Number

Description Batch

8 AN960JD516

Washer M102929 ✓

26.0

AN9704

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Qty Part Number

Description Batch

1 AN970-4

Washer M102929

27.0

MS21042L3

Nut



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Qty Part Number

Description Batch

12 MS21042L3

Nut (or -3) M102217 ✓

28.0

MS21042L4

Nut



Comment: Qty.: 13.0000 Each(s)/Unit Total : 13.0000 Each(s)

Qty Part Number

Description Batch

13 MS21042L4

Nut (or -4) M19185 ✓

PC 7/2/19 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 5/10/22

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:55:55 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L/L3/L4 HIGH GEAR SKID

Job Number: 29321

Part Number: D206642412

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

C 07/02/20 (1)

30.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-412

Location: _____

PPP Rev: C

C 07/02/20 (1)

C 7/2/20 (1)

31.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

C 07/02/20 (1)

Job Completion



U 07.02.22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:57:56 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206 L HIGH GEAR SKIDTUBE
 Job Number : 29321A
 Estimate Number : 10522
 P.O. Number : *N/A*
 This Issue : 11/6/2006 S.O. No. : *N/A*
 Prsht Rev. : NC
 First Issue : *N/A* Type : LANDING GEAR
 Previous Run : 29322A
 Part Number : D206642441
 Drawing Number : D2650 REV E
 Project Number : N/A
 Drawing Revision : E
 Material : *N/A*
 Due Date : 11/30/2006 Qty: 1 Um: Each
 Written By : *[Signature]*
 Checked & Approved By : *[Signature]*
 Comment : Est Rev: H 08.10.11 Added D3429-1 per CHG004 KJ/CP/JLM

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
1.0	DC	DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-441 CHG002

N/A

2.0

D2620

Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2620

Bent Tube 3" OD

*B28932**DP 6-12-21 ①*

3.0

D2647

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2647

Fwd Cap

*B24842**BE 07-01-08*

4.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

2-Remove ridge on inside of Fwd edge of tube as per Dwg D2650

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

A/R Aluminum Rod

*M 11010**BE 07-01-08*

4-Grind weld flush to cap on top surface only.

*BE 07-01-08**DP 6-12-21*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:57:56 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 29321A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

5-Cut aft end 138.60" from front of tube *RT 07-01-09*

6-Drill pilot holes using drill jig DT8025 & DT8169 (A,B,C,D). Open to Ø0.312". *DP 7-1-9*

7-Drill holes for wearplates using DT 8028-7. Open to Ø 0.297".

8-Open using #6 Drill Bit

9-Open holes for Tow Ring to Ø0.625" as per Dwg D2650, D2650-7 Drilling Detail

10-Remove inner indexing ridge on aft end of skidtubeas per Dwg D2650

11-Deburr and Blow out all chips form inside the tube

5.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

Prng JB 7-1-10 (1)

6.0

D26547

206 I Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2654-7

Web

B 29333

JB 7-1-11 (1)

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-7 Drilling Detail (without cutting fluid)

2-Countersink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr. Blow out chips. Grind alodine off around crossbolt spacer.

4-Bond D2654-7 web in place as per QSI 015Ensure holes line upAllow 12 Hrs. cure time before cutting

Start Date: *7-1-11* Time: *1:30*

Finish Date: *7-1-15* Time: *11:30AM*

A/R Sikaflex-291

102672

Sikaflex expiry date:

07-02-01

DP 7-1-11 (1)
JB 7-1-11 (1)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:57:56 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 29321A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 07-01-15

9.0

D2649

Crossbolt Spacer



Comment: Qty.: 23.0000 Each(s)/Unit Total : 23.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

23 D2649

Crossbolt spacer

BE 29329

BE 07-01-15

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert cross bolt spacers D2649. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

A/R Aluminum Rod m/0/0/0 BE 07-01-15

2-Grind welds flush as per Dwg D2650. Masking Tape access to inside of the Skidtube

pm 07-01-15 (1)

3-Counterbore 5/16" x 0.750" deep as per Dwg D2650 Deburr

pm 07-01-15 (1)

11.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2680-041

Nut Plate

B21203

pm 07-01-15 (1)

12.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 CCR264SS3-3

Rivets

m18548

pm 07-01-15 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:57:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 29321A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 M7885/3-4-3

Rivets

m19099

pmc07-01-15①

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

pmc07-01-15①

15.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

M 07/01/16 ①

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

M 07/01/16 ①

17.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White (Ref. 4.3.5.1) as per QSI 005 4.3

Make sure Nut Plate Thread protected use paint screw

M 103141

mky/y 07/02/05 ①
HPT 07-02-01 ①

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

a.m 67/12/06 ①

19.0

D26483

Wearpad



Comment: Qty.: 6.0000 Each(s)/Unit Total: 6.0000 Each(s)

Pick:

Qty Part Number

Description Batch

6 D2648-3

Wearpad

B29226

20.0

D265615

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

FX/y 07/02/05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:57:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 29321A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

1 D2656-15

Wearshoe

B28694

21.0

D265623

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-23

Wearshoe

B24846

22.0

D265637

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-37

Wearshoe

B27473

23.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3429-1

Wearpad

B24201

24.0

ALS41032130

Insert



Comment: Qty.: 60.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 ALS4-1032-130

Inserts

m102475

or (see QSI 017)

25.0

AN960JD10L

Washer



Comment: Qty.: 60.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 AN960JD10L

Washer

m102217

FR/Y 07/02/06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:57:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 29321A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

26.0

MS27039108

Screw



Comment: Qty.: 60.0000 Each(s)/Unit Total : 60.0000 Each(s)

Pick:

Qty Part Number

Description Batch

60 MS27039-1-08

Screw

m 101537

27.0

D26511

Plug



Comment: Qty.: 22.0000 Each(s)/Unit Total : 22.0000 Each(s)

Pick:

Qty Part Number

Description Batch

22 D2651-1

Plugs

B29330

28.0

D26513

O-Ring



Comment: Qty.: 22.0000 Each(s)/Unit Total : 22.0000 Each(s)

Pick:

Qty Part Number

Description Batch

22 D2651-3

O-Rings

B29778

29.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 AN960JD416

Washer

B11151

30.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 MS27039-4-06

Screw

B6874

FL/Y

07/02/06

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:57:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 29321A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

31.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2646

Aft Cap B28041

32.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 AN960JD10L

Washer m102217

33.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 MS27039-1-08

Screw m101537

34.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291 m102672

Sikaflex expiry date: 02/07

2-Install O-Rings D2651-3 on plugs D2651-1 with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive

3-Install MS27039-4-06 Screw as per DEO 9153

4-Inspect for foreign object per QSI 024

5-Install D2646 Aft Cap and seal with SikaflexClean excess adhesive

A/R Sikaflex-291 m102672

Sikaflex expiry date: 02/07

6-Wing Walk as per Dwg D2650-7 and QSI 005 4.4

Batch: ~~m103004~~ m103004

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: PD Date: 07/02/22
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/6/2006 1:57:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 29321A

Part Number: D206642441

Job Number:



Seq. #:

Machine Or Operation:

Description :

35.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Joan @



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

36.0

QC5

INSPECT WORK TO CURRENT STEP



Joan @



Comment: INSPECT WORK TO CURRENT STEP

37.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: _____

B 29 321

cc 7/2/00 @

38.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

207/02/22 @

Job Completion



U 07-02-22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DARTRELEASED
16 04 17 #

DESIGN <i>AP</i>	DRAWN BY <i>AP</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	




Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

NOTES

- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED



SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
29321A**Copyright © 1997 by DART AEROSPACE USA, INC.**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

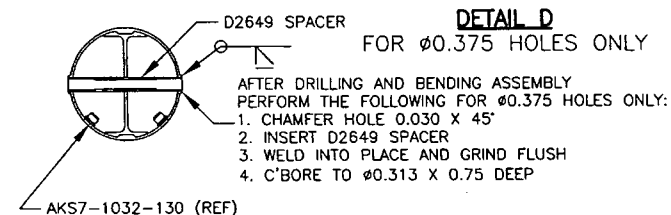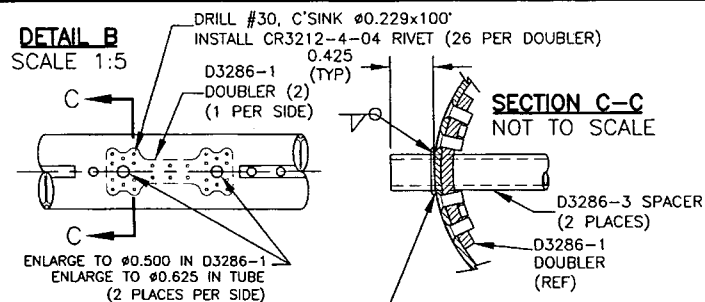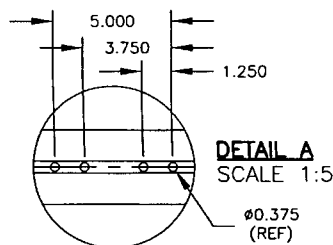

RELEASED



06.04.17

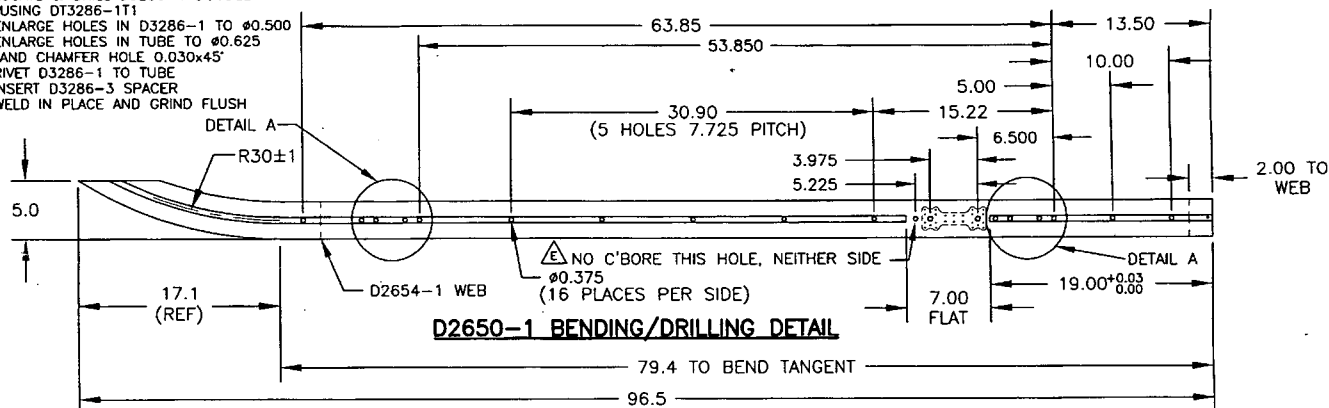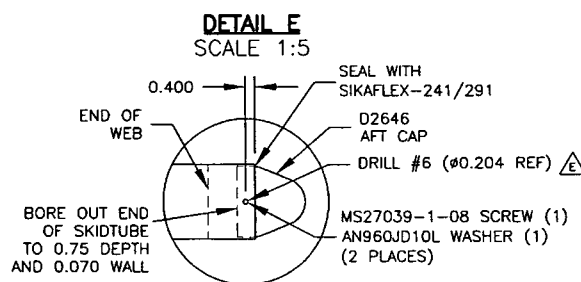

DETAIL F (NOT TO SCALE)



- CUT TUBE LEVEL
- REMOVE RIDGE ON FWD SIDE
- LOCATE D2647 (TRIM AS NECESSARY)
- WELD D2647 IN PLACE PER DART QSI 004
- GRIND FLUSH
- RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

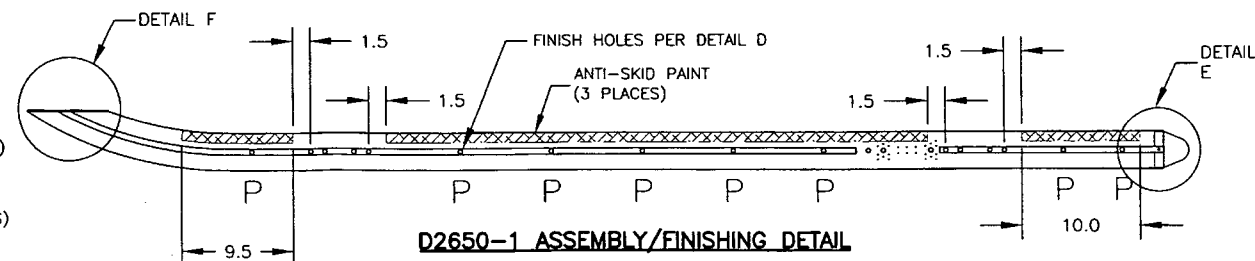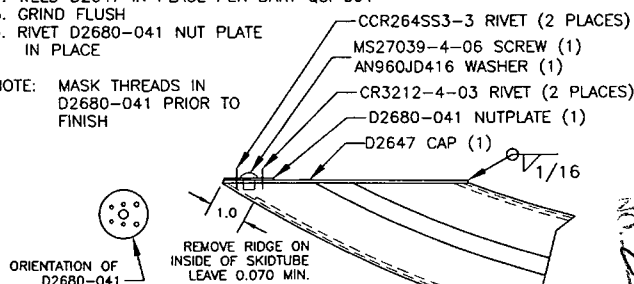


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	
CHECKED	APPROVED	DATE	DRAWING NO.	TITLE	REV. E
R4	H	06.03.30	D2650	SKIDTUBE	SHEET 2 OF 5
				SCALE	1:10

NO. 29321A
WORK ORDER
CONTROLLED COPY
RETURN TO
ENGINEERING
DIRECT TO A
WITHOUT NOTICE

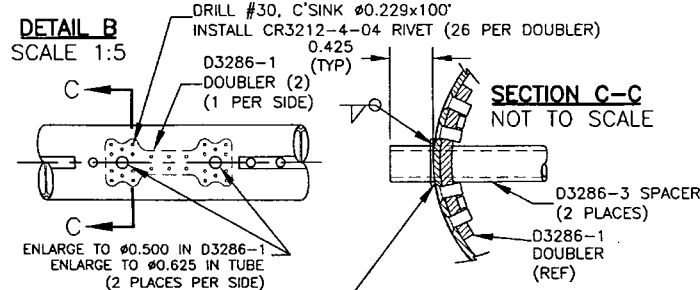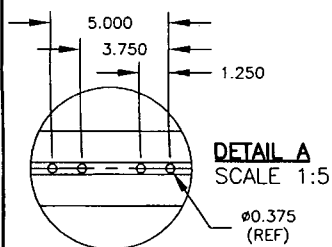

SECTION C-C
NOT TO SCALE


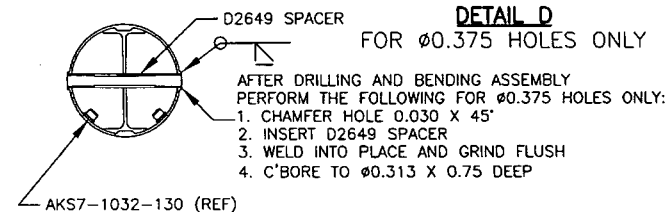


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR 0.375 HOLES ONLY:
1. CHAMFER HOLE 0.030 X 45°
2. INSERT D2649 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE TO 0.0313 X 0.75 DEEP

RELEASED

26.04.7



- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO 0.500
 4. ENLARGE HOLES IN TUBE TO 0.625 AND CHAMFER HOLE 0.030x45°
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE AND GRIND FLUSH

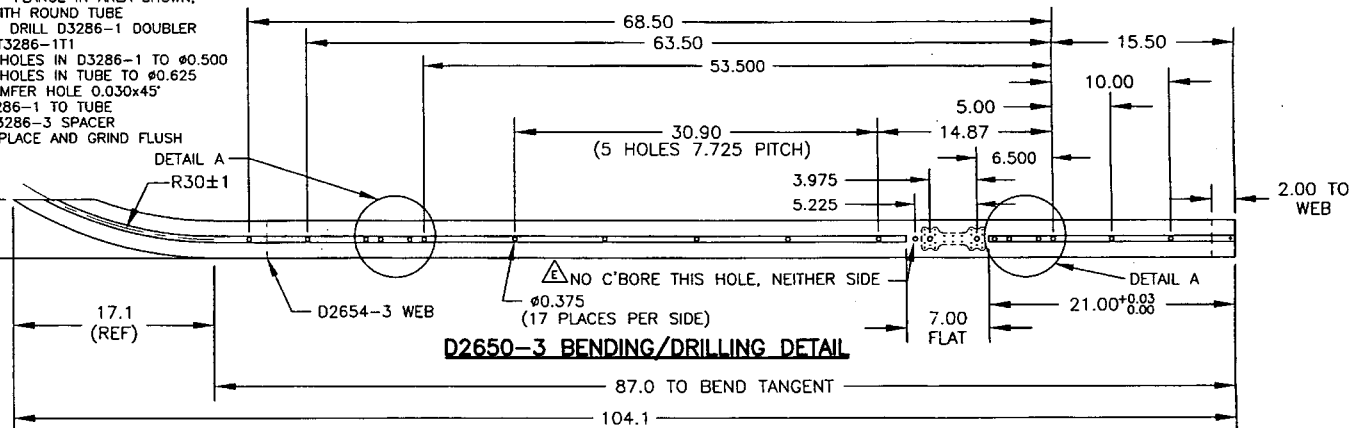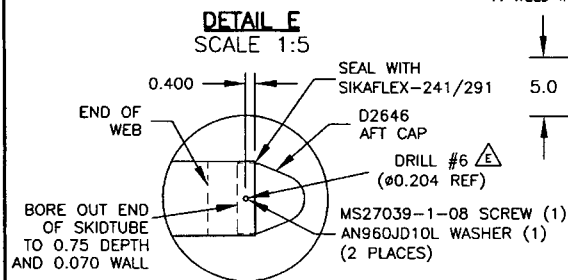

DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH


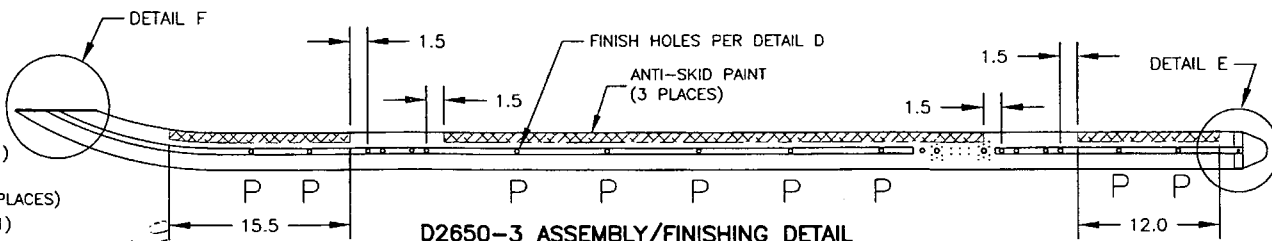
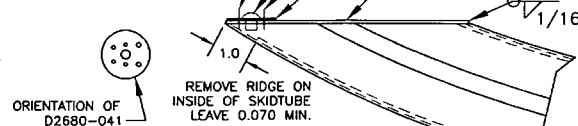


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	DART	DART AEROSPACE USA, INC.	REV. E
CHECKED	PH	DART	SHEET 3 OF 5
DATE	06.03.30	TITLE	SKIDTUBE
		SCALE	1:10

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
29321A

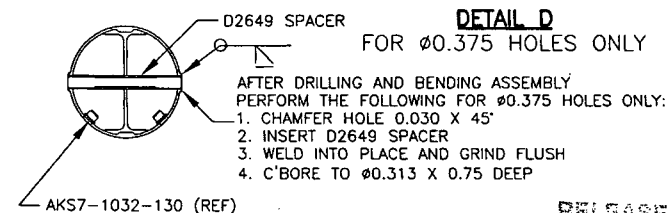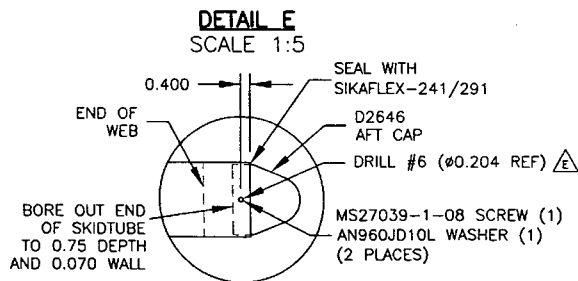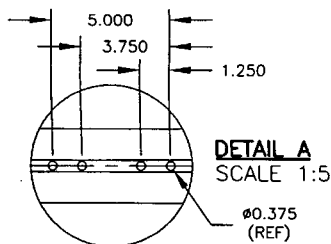


RELEASED

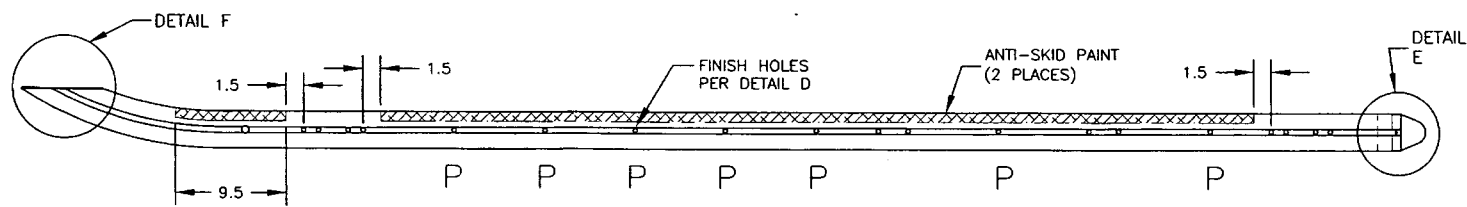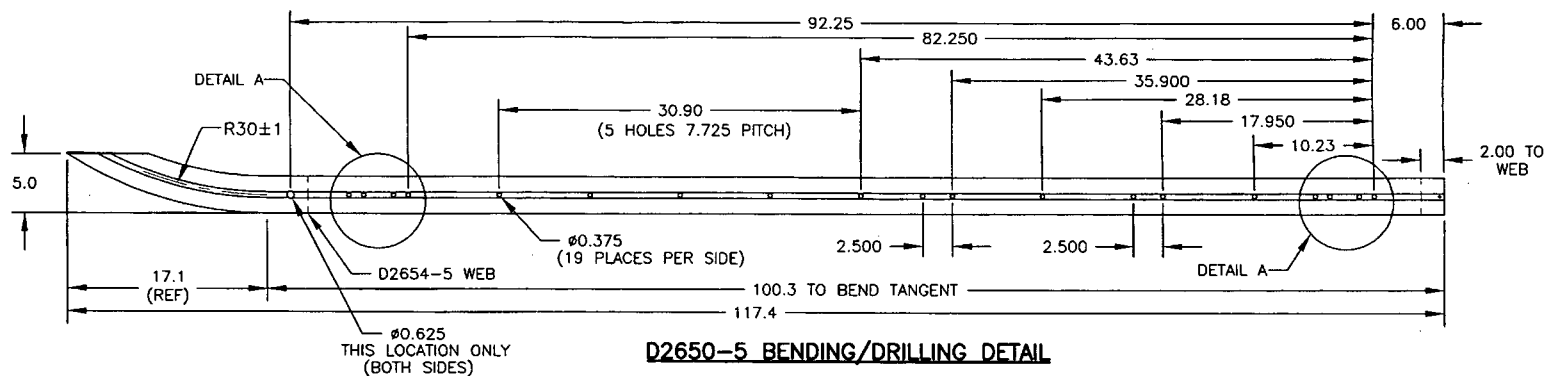

DETAIL E (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE






NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH




REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

NO. 1
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED	PH	APPROVED		DRAWING NO.	REV. E
DATE	06.03.30			D2650	SHEET 4 OF 5
				TITLE	SCALE
				SKIDTUBE	1:10

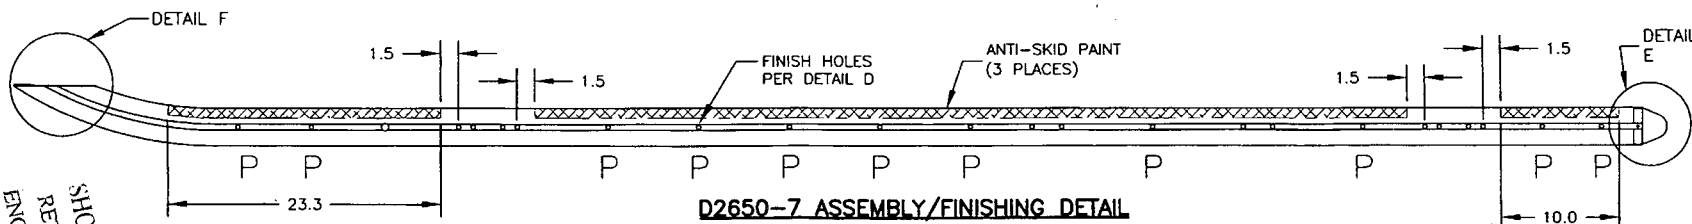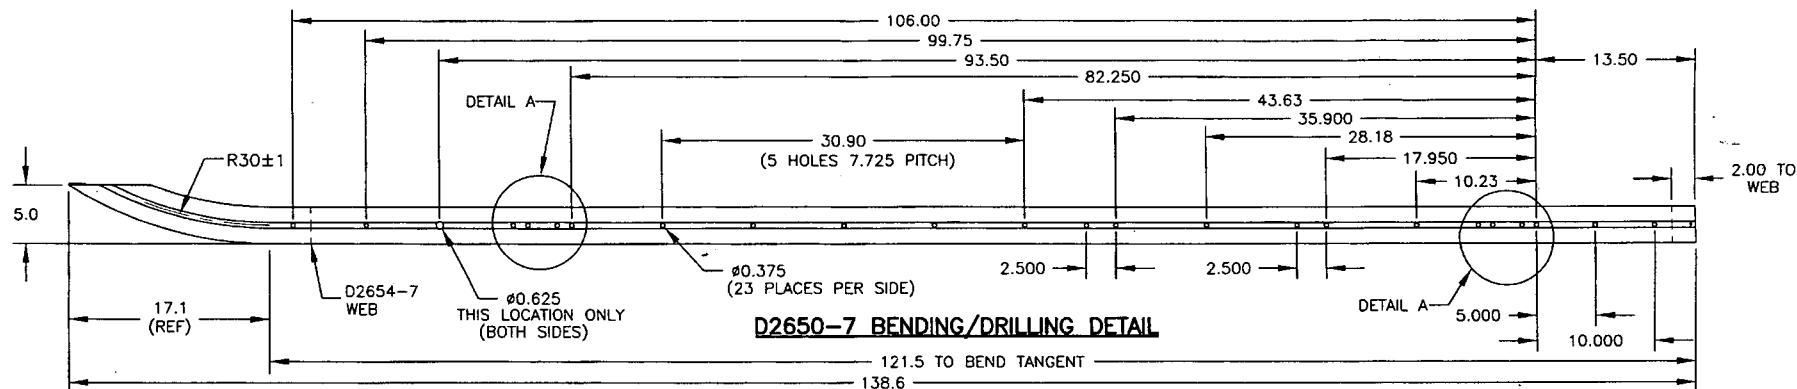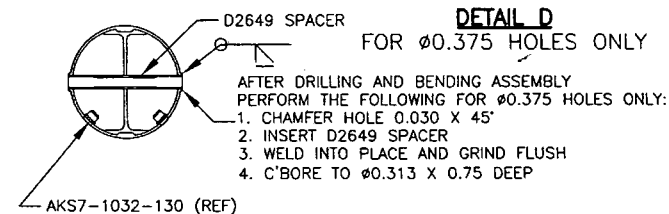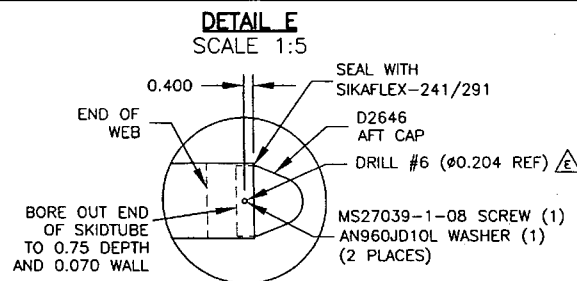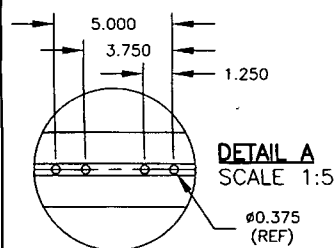

NO. 29321A
WORK ORDER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
REMOVE RIDGE ON
INSIDE OF SKIDTUBE
LEAVE 0.070 MIN.

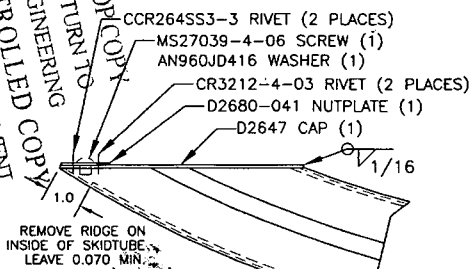

- DETAIL F (NOT TO SCALE)**
1. CUT TUBE LEVEL
 2. REMOVE RIDGE ON FWD SIDE
 3. LOCATE D2647 (TRIM AS NECESSARY)
 4. WELD D2647 IN PLACE PER DART OSI 004
 5. GRIND FLUSH
 6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

RELEASED
00017

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	LP	DRAWN BY	LP	DART DART AEROSPACE USA, INC. PORT HADLOCK, OH	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED	PH	APPROVED	PH	DRAWING NO.	REV. E
		DATE	06.03.30			D2650	SHEET 5 OF 5
						SKIDTUBE	SCALE 1:10

NO. 84

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number A206642341 / A28347A

TEST WELDS REQUIRED

BASE METAL	<u>Alum</u>	WELDING PROCESS	<u>Tig</u>
Penetration	Complete <input type="checkbox"/> Partial <input checked="" type="checkbox"/>	Single Weld <input checked="" type="checkbox"/> Double Weld <input type="checkbox"/>	
Current AC <input checked="" type="checkbox"/> DC <input type="checkbox"/>		Backing YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>	
	Position	Vertical Down <input type="checkbox"/> Up <input type="checkbox"/>	
Sheet Groove	1G <input type="checkbox"/> 2G <input type="checkbox"/> 3G <input type="checkbox"/> 4G <input type="checkbox"/>		
Tube Groove	1G <input type="checkbox"/> 2G <input type="checkbox"/> 5G <input type="checkbox"/> 6G <input type="checkbox"/>		
Sheet Fillet	1F <input type="checkbox"/> 2F <input type="checkbox"/> 3F <input type="checkbox"/> 4F <input type="checkbox"/>		
Tube Fillet	1F <input type="checkbox"/> 2F <input type="checkbox"/> 4F <input type="checkbox"/> 5F <input type="checkbox"/>		
Crossbolt Spacer Welded into		Skid <input type="checkbox"/>	

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/01/09 Qualifier David Auld

Jason Murdoch

From: Bill Beckett [bbeckett@dartaero.com]
Sent: Monday, February 05, 2007 1:10 PM
To: 'Jason Murdoch'
Cc: 'L Lacelle'
Subject: RE: sikaflex-291

Jason,
Yes.
Bill

From: Jason Murdoch [mailto:jmurdoch@dartaero.com]
Sent: February 5, 2007 12:49 PM
To: 'Bill Beckett'
Subject: sikaflex-291

Bill,
We have 25 tubes of sikaflex-291, batch M102672, that expires at 02/2007. Is it acceptable to use the remainder until the end of this month?

jmurdoch@dartaero.com
Q.C. COORDINATOR

Jason Murdoch

From: Bill Beckett [bbeckett@dartaero.com]
Sent: Monday, February 05, 2007 1:10 PM
To: 'Jason Murdoch'
Cc: 'L Lacelle'
Subject: RE: sikaflex-291

Jason,
Yes.
Bill

From: Jason Murdoch [mailto:jmurdoch@dartaero.com]
Sent: February 5, 2007 12:49 PM
To: 'Bill Beckett'
Subject: sikaflex-291

Bill,
We have 25 tubes of sikaflex-291, batch M102672, that expires at 02/2007. Is it acceptable to use the remainder until the end of this month?

jmurdoch@dartaero.com
Q.C. COORDINATOR